




DON GRAY ELECTRICAL SUPPLIES
Electrical Wholesalers and Manufacturers Agents
312 PASCOE VALE RD, ESSENDON 3040
ph 9 326 2223 fax 9 326 2191
ABN 43 858 523 981

BOLT ON HOT WATER SERVICE ELEMENTS – SICKLE FORM

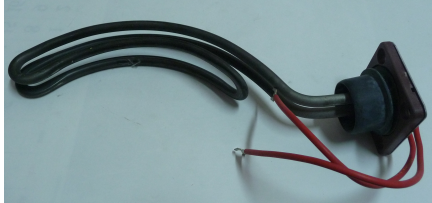

CORROSION RESISTANT INCOLOY SHEATH

RESISTOR FOR GLASS LINED TANKS

AVAILABLE OPTIONS:

- HAIRPIN FORM
- FOLDBACK FORM
- SICKLE FORM

PART NUMBER	WATTS	PENERTATION LENGTH	SHEATH LOADING
1.5KWSICKLE	1500	305mm	120KW/M2
1.8KWSICKLE	1800	305mm	120KW/M2
2.4KWSICKLE	2400	305mm	120KW/M2
3KWSICKLE	3000	305mm	120KW/M2
3.6KWSICKLE	3600	305mm	120KW/M2
4.8KWSICKLE	4800	305mm	120KW/M2

INSTALLATION RECOMMENDATIONS:

- **NEOPRENE GASKET SUPPLIED IS FOR USE IN H.W.S TANKS WITH STANDARD 64mm APERTURES**
- **FOR OLDER MODEL TANKS (GRAVITY TYPES etc) WITH A SEALING GROOVE MACHINED IN THE APERTURES, USE BOTH EXTENDED & L SECTION GASKETS**
- **TO ASSIST CORRECT POSITIONING WHEN INSTALLAING, CONSIDER USING SILICON ON GASKETS.**
- **DRAINING AND FLUSHING H.W.S TANK TO REMOVE SLUDGE AND BUILDUP WILL ASSIST IN PROLONGING THE ELEMENT LIFE**
- **WHEN REPLACING ELEMENT, INITIALLY FINGER TIGHTEN THE RETAINING BOLTS, THEN USE A TORQUE WRENCH TO TIGHTEN TO A MAXIMUM OF 8NM – TIGHTEN BOLTS IN THE SEQUENCE OF 2, 8, 4, 10 O’CLOCK POSITIONS**
- **OVERTIGHTENING BOLTS OR INCORRECTLY INSTALLING GASKETS MAY CAUSE LEAKAGE TO OCCUR**